

Seymour Texas
Feb 8 1927

Field notes of connecting lines in
Baylor County

1st Beginning at a stone mid the NW Corner
of Survey No 24 cut no 1071 H+TC RR
Thence $87^{\circ}19' E$ 94 vs to stone mid
on north slope of Hill the location
SW Corner T & N O RR Co Survey No 263
by Mr R. M. Kinney.

Thence north 667 vs stone mid for S.E. Cor
Survey 262 T, N, O, R.R. Co.

Thence West at 15 vs a branch, 895 vs a
branch 1482 vs whiskey creek (tributary)
at 1900.8 vs stone mid NW corner 262 and NE
25-8.

Thence West at 820 vs 900 vs and 975 vs
cross and recross whiskey creek, 1450 vs
top of hill, 1750 vs top of another hill at
1900.8 vs SE Cor 25-9 - SW Cor 260.

Thence West at 82.4 pass 25 vs north of stone mid
at 550 vs center of Vernon and Seymour Road
at 1100 vs a point on Lake Kemp for a triangulation
point - whence NW corner 256 and NE corner
253 brs $71^{\circ}55' W$. Return to 550 vs West
of SE Cor 259 at point in Seymour & Vernon Road
Thence $79^{\circ}35' N$ 3500 vs in same road
Thence No 6' N 420 vs at SW corner survey
No 15 - B. E. K. & H. T. C. R. R. Co.

2nd Beginning at stone mid at NE corner 262

Thence North 950.4 vs, st. mid mid NW 263

Thence East 1900.8 vs NE Cor 263 at 3773.8 vs

1 at 4721.6 vs cross Ranch Road corner S.E.
2 at 5692.4 vs cross West Hackberry Creek
3 at 5702.4 vs to N.E. corner 266. (new count
4 Thence East 135 vs a point whence S.W. corner
5 of survey no 6 Block 6 H.T.C.R.R.C.
6 vs north 418.4 vs identified by the
7 Kenney's bearings at 1900 vs built
8 stone md for N.E. corner 267 and N.W. 268.
9 Thence East 361 vs a point on East bank
10 of East Hackberry Creek, whence S.E. corner
11 Survey no 6 Block 6 H.T.C.R.R.C. vs
12 north 1108.5 vs at 418 vs pass 6 vs
13 north of Horse shoe bend in Hackberry Creek
14 this is evidently the part of the creek
15 called for in Field notes of Survey no 1
16 G.C. & S.F. at 1679 vs a fence N and S
17 at 1788 vs a point for S.E. corner survey
18 no 1 G.C. & S.F. R.R.C.
19 Thence S 23 vs to fence at 25 vs a
20 transit point. Thence West at 90 vs
21 pass 10 vs S of old stone md. possibly
22 Mr D.H. Jones corner. at 103.2 vs a point
23 on fence line
24 Thence S 3° 45' E with fence. at 2066
25 to stone set by Sam L. Chalk
26 Thence West 25 vs to S.W. corner Survey no 14
27 H.T.C.R.R.C. by Mr Kenney.

28
29 I hereby certify that the foregoing survey
30 is in all respects true and correct and
31 according to law.

32 Witness my hand at Seymour Tex
this Feb'y 8th 1927
A. D. Kerr,

Sk. File No. 23 (a)

Baylor Co.

Filed Feb. 11, 1927.

- See Sk. filed same date.
Surs. in N.E. Cor. County.

Letter & Connection
filed Feb. 11-1927

J. J. Robinson - Com
H. F. McDonald - Clerk.

(See sketch filed same date
as this connection,

2.00

Counter 14206

3+

A. D. KERR

LICENSED LAND SURVEYOR



STATE OF TEXAS
COUNTY OF
BAYLOR

AND COUNTY SURVEYOR
OFFICE AT COURT HOUSE

SEYMOUR, TEXAS,

RECEIVED
Feb 8th 1929

FEB 11 '29

REFERRED TO MAP

121

Hon J. J. Robison
Comr Genl Ld Office

Dear Sir

I have some connections between the H & T C R R Cas Lands and on the River and surveys in blocks 3 & 6 same Co, narrowing are survey 259 258 263, 264 etc and also surveys in names of G. C. & S. F. R R Co, Hooper and 1 - 2 and the Harrison Proemmett Survey.


I am inclosing Field notes of connecting lines and corrected Field notes of surveys 266. T M O R R Co. Survey no Hooper and Wade and Survey no 1 G. C. & S. F.

I beg leave to state that I recognized all former locations of the following surveys To wit: Mr Kenney's Corners in the H & T C R R Cas land, the NW corner of the B & E Borden Survey ^{no 1.} and the Crossman Corner of 253, 255-256 and 254 T M O R R Co Survey.

It might be well for me to make a statement

A. D. KERR

LICENSED LAND SURVEYOR

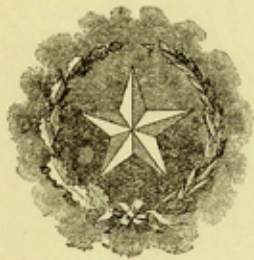

STATE OF TEXAS
COUNTY OF
BAYLOR

AND COUNTY SURVEYOR
OFFICE AT COURT HOUSE

SEYMOUR, TEXAS.

19

in regard to NE corner survey No 253.
This corner has two locations the first made from
NE corner survey No 10 and the other from
NE corner 252, Mr W A Jones and I agree
on that corner and I recognized it in
Field notes of W's 252 for A H Jeter.
The later corner is only about 2 rods north
of the first named located from NE corner
Section 10. So that the line from the east
was not materially affected by their difference
North and South of 2 rods.

If west line of 263 is correct
at 1591 rods as per Mr Kinney, the West end
of Le E Borden survey will be 161 rods instead
of 187. ~~and~~ ^{but} since there is an excess north
of Borden I adjusted the 5010 RR surveys
accordingly. I am however at your
service in this matter. Please advise
as soon as possible.

Yours truly

A. D. Kerr,
Co Surveyor.

Gave R L Moore
vernon Ly
3 field notes
which I recognize
he sent you