

Statement to Hon. J. H. Walker.

Commissioner of Genl. Land Office Austin
Tex. in connection with my resurvey of
Sec. No 12- Block No 6, cert. No 125-
L & S V.R.R. Co. Reagan County Texas,
We have the original, at N.E. corner No 1
BLK C- the N.W. cor. of No 6 BLK B, the
S.E. cor. of No 48 BLK 37 and the SW cor
of No 43 BLK 36 T & P RR Co - common
corner of four blocks. This corner was
also identified by Robt E. Estes - May 3rd
1928, a clump of young mes. from old
stumps br. 1854W 56 $\frac{1}{3}$ m. corner is an old stone
mto which I added an iron pipe. At N.E. corner
of No 6 BLK B- is a stone Md. & iron pipe
set by R.E. Estes whence a clump. of small mes.
ft on old stumps br. N 78° E 15.5 m - a pile of
rock. where Estes found remains of a
partly decayed Md. stumps br. N 69° E 23 m.
I consider this corner is identified as
original - measured distance of N. Line
of Sec. 6- in 1907⁵ m. just as Estes found it
953⁵ S 77 W from N.E. corner of No 1- is an
old stone Md. at original $\frac{1}{4}$ See. corner
The N.W. corner of No 1 BLK 6- I could not
identify as original but there is a corner
1906.8⁵ S 77 W of N.E. cor. of No 1 which
I adopted. The N.E. cor. of No 1 and the $\frac{1}{4}$
See. corner on N. Line of No 1 and the N.E.
cor. of No 6 BLK B- are all on a line
run along the common corner of
the four blocks - at N.E. corner of No 1
BLK 6- I turned an angle of 90° from
N. Line of No 6 BLK B- and ran
transit line 85723 $\frac{4}{5}$ m. and hit a deeply
sunken m. of small stones which I
+ counter 35002

2


think is original S.E. corner of 13 Blk C
and S.W. corner of 18 Blk B. There
is no other rock pile in this locality
and this md. has been placed by human
hands as the rocks are of different kinds.
The md was covered by earth and turf
and only three small rocks were visible
scattered over a space about 3 feet
square. I dug down with point of flag
pole and steel pins and the hidden
^{was found} mound distributed the 5723⁴ in.
between the 3 sections giving each section
1907⁸ in. putting a stone md and iron
pipe at each section corner. See
sketch. The work is right angle work
with transit. - needle indicated a
variation of 13-34° E - I ran S77W from
N.E. corner of 12 Blk-C 1906.8 in. set I.P.
& stone md. for N.W. cor. of 12-. Thence
S13E 1907⁸/in. hit old stone md. made
by H.E. Dickerson Aug. 13- 1910 for N.E. cor.
of sec. 14- Blk C. In his survey of $\frac{1}{2}$ of 14
for B.R. Davis. I Geo. M. Williams

Licensed State Land Surveyor
do hereby certify that the above and
foregoing statement is true and correct.

Given under my hand and seal of
Office at Spur Fox this the 30th day of
July 1932.

Geo. M. Williams

Licensed Land-Sur.

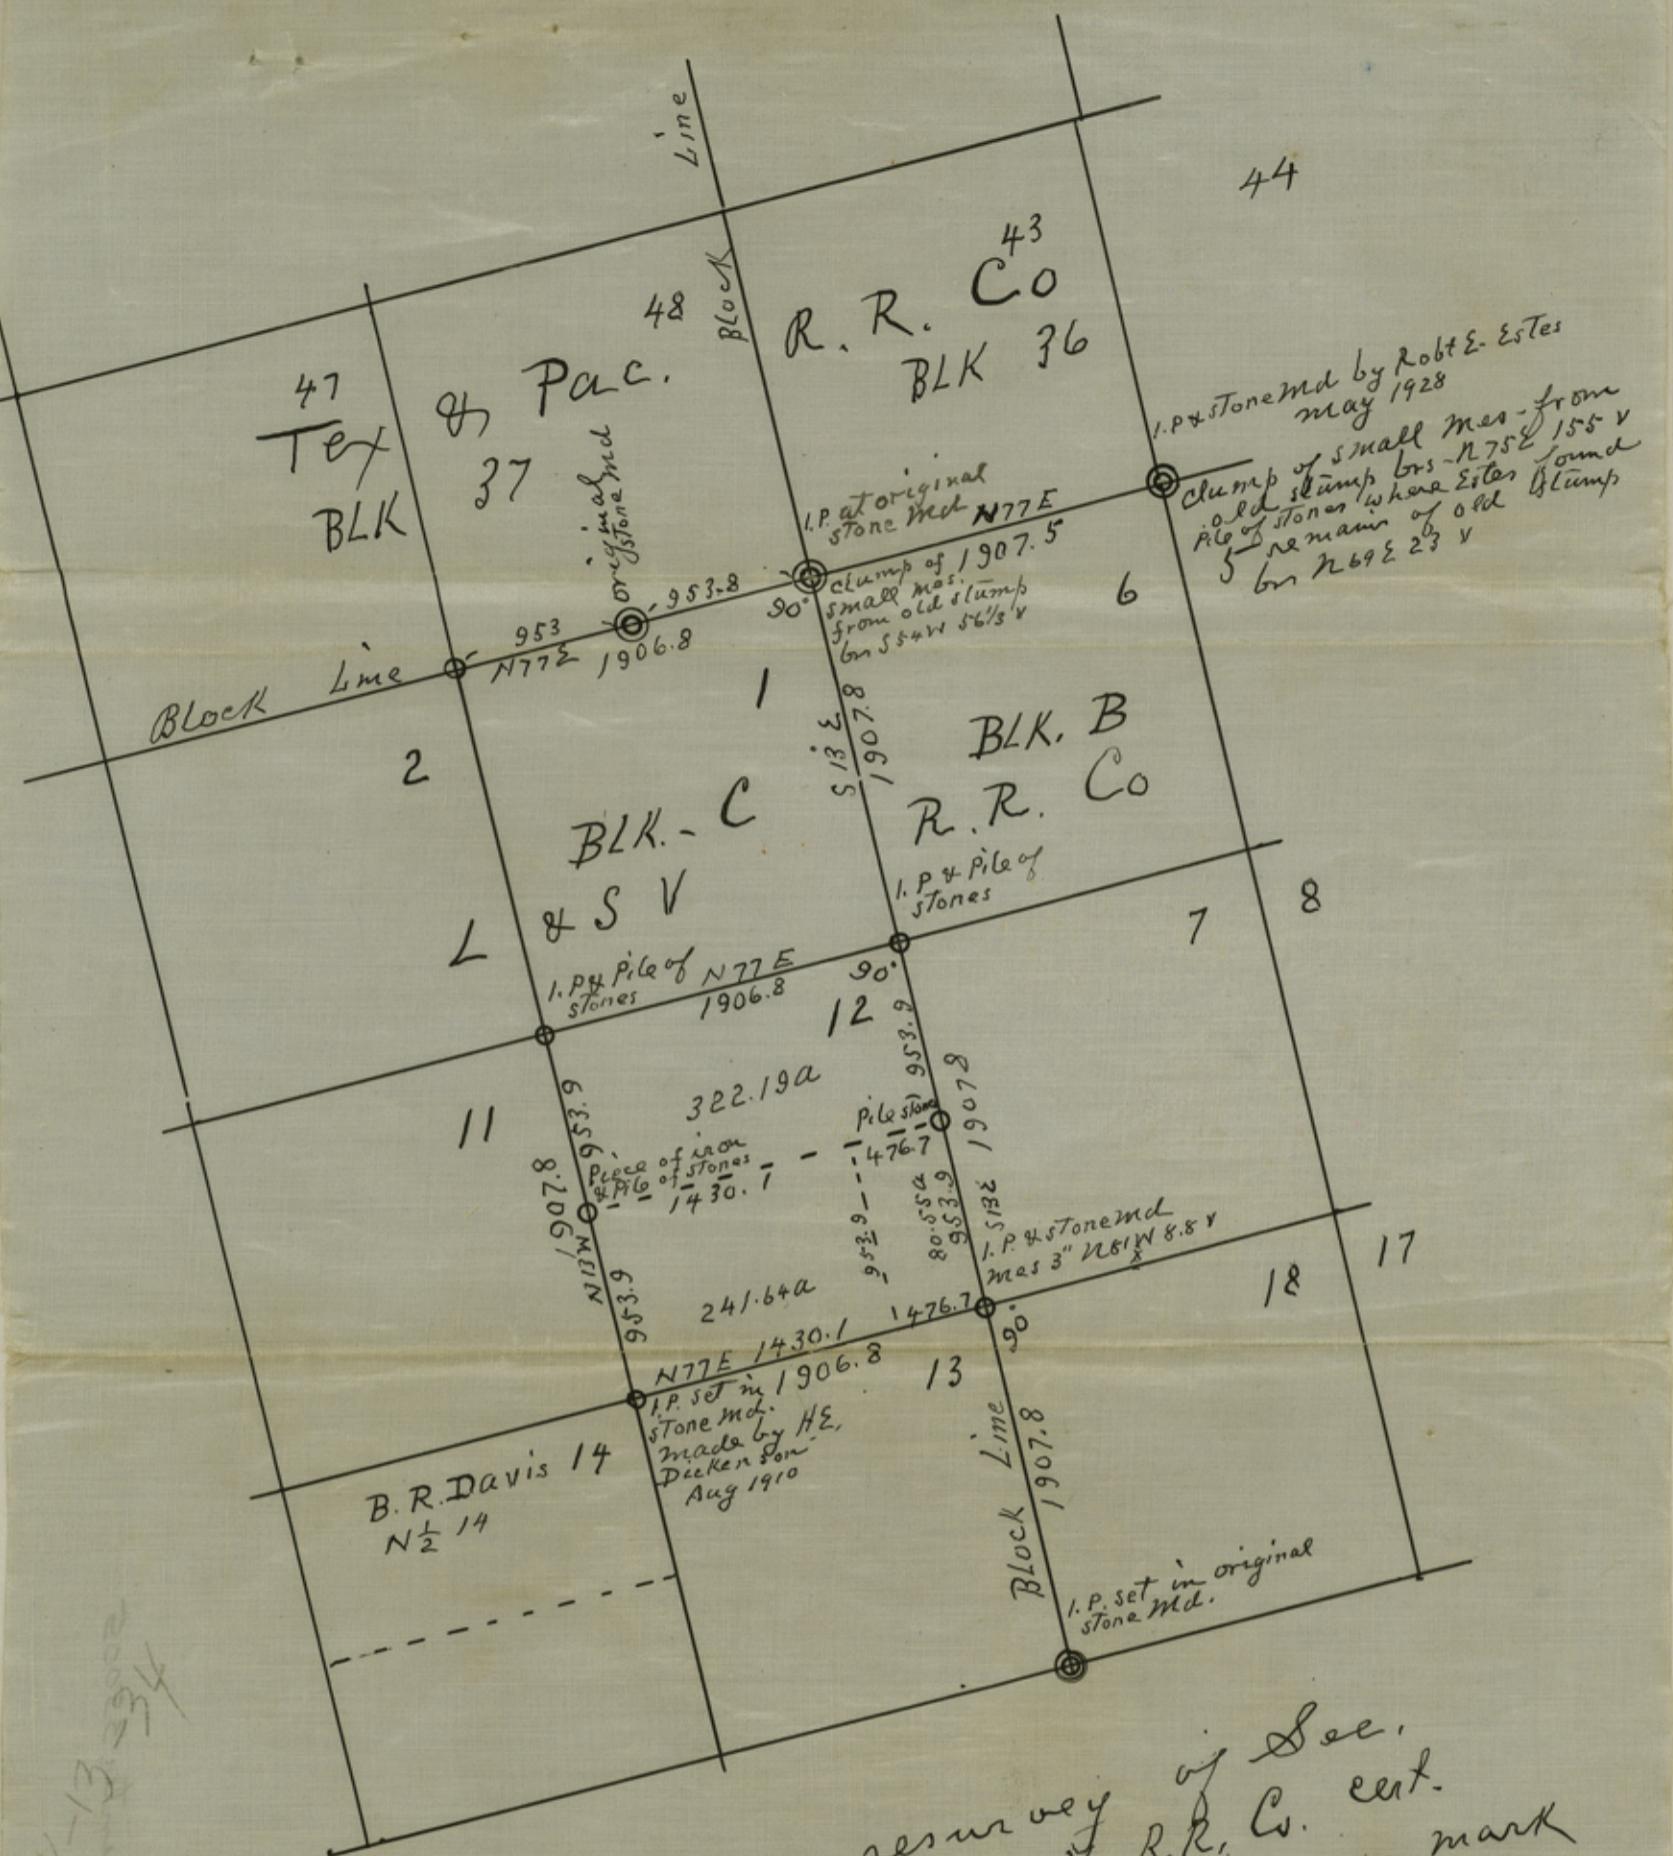

Sketch to explain my resurvey of See.
 No 12 Block C. L & S V R.R. Co. cert.
 No 125 in Reagan County Tex. corners mark
 thus \odot indicate original corners identified on
 the ground. made by H.E. Dickenson Aug. 1910 - for the
 stone md. made by H.E. Dickenson - All distances shown were measured on
 the ground. All distances shown were measured on this
 work. \odot Geo. M. Williams 13.34 sq. ft. will retrace land
 surveyor or do hereby certify that this sketch
 is true and correct. Hand and seal of Office this
 30th day of July 1932
 Geo. M. Williams
 licensed Land Surveyor
 counter 135004

Sketch File No. 16

Reagan Co Conn

Geo M. Williams Sk

and Statement

August 11th 1932

J. H. Walker, Com.

cher
- File C

Descriptive: Vicinity Set 12 Blk C.

L & SW RR Co